- How did we define quality?
 - For LHC quality is based on fitness for use.
- Quality requirements (a.k.a. design inputs) were defined by CERN and US-LHC.
 - Documented in the LHC Parameters and Layouts database and in the Technical Design Handbook (TDH).
- See section 6.2 of the QA Plan.

- How do we ensure we have fulfilled the quality requirements?
 - Design outputs, i.e. drawings & specifications, document that the requirements have been met;
 - Reviews, such as this one, help us to determine if we have missed anything;
 - Q2P1 validated the design and production process.

- How did we document our QA program for the project?
 - The US-LHC PMP states in section 4.2.10:
 - "... The QA programs for each component of the US Project will be developed within the context of the relevant laboratory's normal QA program and procedures..."
 - Our approach was to combine the CERN defined requirements with our existing Technical Division QA program;
 - Worked with Jim Kerby and Phil Pfund;
 - The result is the QA Plan you currently have.

- Technical Division organization:
 - Departments directly involved with LHC:
 - Machine Shop;
 - Material Control provides procurement, incoming inspection, warehousing and kitting;
 - Engineering & Fabrication;
 - Development & Test provides the final measurements of the devices.

- Section 4 Documents and Records;
 - In the TD uses its normal systems to control documents and records;
 - ER/ECO drawings are formally approved, issued, distributed, and revisions are controlled;
 - Documents relating to production are under document control (distribution maintained and revisions controlled);
 - travelers, forms, operating procedures.

- Section 4 (con't)
 - Records from production are scanned and indexed in OnBase, and are available over the WWW;
 - Data point: we estimate there are at least 1750 pages of production records for each complete cryostated assembly (travelers, DR's, kit lists);
 - Data from quench and magnetic measurements are stored in a database.

- We also have unique CERN-defined requirements:
 - I All drawings will be provided to CERN, and will eventually reside in EDMS;
 - All records for the production of devices will be provided to CERN, and will eventually reside in EDMS;
 - Measurement data and results will be provided to CERN...
- See section 4 of the QA Plan.

- Section 5 Work Processes:
 - TD uses its normal systems for managing work processes, e.g. travelers, operating procedures (OPs), discrepancy reports (DRs);
 - TD travelers:
 - define the sequence of fabrication, inspections and testing to be performed for the devices;
 - provide witness/hold points for critical tasks;
 - provide sign-off and date at each completion of fabrication sequence, welding operation and inspection/test operation.

5.5 Record the Length from the Outer Edge of the Lead End Plate to the Outer Edge of the Non-lead End Plate before welding.

All Quadrant lengths must be with in .030" of each other.

		Position of the Measurement	Measurement in Inches	Range
		Q1	225,812	225.801" to 226.301"
		Q2	225.812	225.801" to 226.301"
		Q3	225, 875	225.801" to 226.301"
		Q4	225 812	225.801" to 226.301"
		Technician(s)	ī	Date 12/15/2005
x	5.6	Verify that the End Plates are		Coldmass Assembly (ME-369578). i 2/15/00 Date
	5.7		e is in position as per the Final Colo Legad End Plate to the Cold Mass S	
	5.8		tainless Steel Wire Brush (Fermi st 300), Kimwipes (Fermi stock 1660	
	5.9			
	5.10		ess Steel Wire Brush (Fermi stock 1900) and Kimwipes (Fermi stock 19	

5.11 Record the Length from the Outer Edge of the Lead End Plate to the Outer Edge of the Non-lead End Plate after welding.

For Reference only.

Position of the Measurement	Measurement in Inches	Nominal
Q1	225.750	225.926"
Q2	225.750	225.926"
Q3	225.750	225.926"
,Q4	225.750	225.926"
10		

Technician(s)

13/18/3000

	6.0	Bolt and Bullet Installation		
		6.1	Apply Areolex (open Purchase - Chemical Research Co.) to installed onto the End Plates except the bolts. Apply anti-se (MB-469267)	all threaded parts being size to the Axial Preload Bolts 2 -/8'
			recunician'	Date
		6.2	Assemble the Bullet Assemblies (MD-369293) for the Lead	and Non-Lead End.
			11.11/2	72 - 18 - 0-0 Date
			Technician	Date
78° 28*		6.3	Install the Bullet Pusher Screws (MB-344583) and the Bullet (4) places on the Lead End and (4) places on the NON-Lead careful not to damage the wires or the solder connections.	End as per (ES-369708). Be
256			Vechnician	Date
0,		6.4	Perform a Check of the Bullet Strain Gauges at 0 Pressure in (ES-369708).	n accordance with
			J.Pa.	21 DEC 7000
			Inspector	Date
		6.5	Torque the Axial Preload Bolts while monitoring the Bullet as per (ES-369708).	Pusher Screw Strain Gauges
			Note(s): Before the final torque is applied the Production Physicist are to be present. Technician	Engineer and/or Magnet
	x	6.6	Verify the stabilization of the Torque applied to the Bullet F anomalies occurred during this process, state "no anomalies	
			Comment:	
			Responsible Authority/Physicist	1-2-01 Date
		6.7	Send the Bullet Strain Gauge Data to the Process Engineering	ng Sever.
			A) \ a	
			Technician	Date

- Travelers (con't)
 - I Travelers have proven extremely valuable for being able to reproduce the same item over and over;
 - I These are living documents, and evolve as we learn;
 - They provide us with a record of what we did, and so they are one of the first things we review if problems arise (which, of course, never happens);
 - We have developed, and are using, ~25 travelers in the cold-mass production process.

- Operating procedures define the operations for a specific process or piece of equipment, e.g. coil winder;
- I TD discrepancy reports:
 - are used to document problems during assembly or fabrication;
 - the cause of the problem is identified and recorded;
 - the device in question is dispositioned, e.g. repair, scrap, use as-is;
 - action(s) are identified and implemented to prevent the problem from recurring.
- See section 5.4 and Appendix II of the QA Plan.

Rev. J

1) Traveler Title		2) Specification No.;	3) Revision:	4) DR No.:					
LHC	Cold Mass Final Assembly	5520-TR-333498	3) Kevision.	HGQ-0158					
5) C									
5) Step No.:	6) Drawing No. & Revision:	7) Serial/Component/Item/Bato	h/Lot No.:						
7.2	5520-ME-369578	MQXB-001							
8) Nonconforma	nce Description by First Hand Obser	rver:	Class 1	Class II					
Bullets were be	Bullets were below specs given by Rodger Bossert.								
	or speedgreat by reager bossess.								
1									
9) Name Steve (3ould		Date: 1/3/01						
10) Cause of Nor	conformance:		Dute	, .,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,					
" Cree	en tall in Lillat no		-4	دا ا					
	ep" in bullet re	adings due to	Stress	LEIDKALION					
	of coils.								
	0 1 0								
11) Responsible	Authority Redge B	<u> </u>	Date	: 1/3/01					
12) Disposition:	0								
_									
T	ghten axial pro	cload bolts to	bring	bullet					
100	ading back into	spec.							
11\ D	P. A. A.	1							
11) Responsible A	authority Color Cartinority Color to Prevent Recurrence:	<u> </u>	Date	: 1/3/01					
15) Collective Al	aton to Frevent Recuttence:								
Α.	dd sten to to	- alla - +	1.5						
Add step to traveller to retighten									
bullets at this point in operation.									
			1						
11) Responsible	Authority Rose B	A Tista E	D.	1/2/21					
11) Responsible Authority Responsible									
0.4. 0.1									
U		. I soo all	wSK_	7/22/01					
11) Responsible Authority Date: 1/3/01 [] Class I [U Class II]									
Will Configuration be affected? [] Yes [] No Process Engineering Manager Date:									
L.		_							
6) Material Manpower Method Machine Measurement									
Process Engineerin	g determine (identify), appropriate p	problem area and check							

- Section 8 Inspection & Acceptance Testing:
 - Inspection & testing comes in 3 flavors:
 - Incoming Material Control's QC Lab IB4;
 - CMM, optical comparitors, dimensions, et cetera (QCRs).
 - In-process Engineering & Fabrication ICB;
 - Includes dimensional measurements, as well as electrical and leak checking (travelers and DRs).
 - Final Measurement & Test Facility (MTF) IB1;
 - Quench and magnetic properties of the devices.
 - See section 8.2 of the QA Plan.


- Appendix II Workflow:
 - Provides a very high level look at the production process;
 - Includes traveler numbers as well as our serialization scheme;
 - It should be noted that we use the TD serialization scheme for the entire process, and then use the CERN-defined scheme to identify the completed assembly.

US-LHC Fermilab Quality Assurance Plan

Appendix II – Fermilab-built Magnet Assembly Workflow

Date: 18-June-2001 Version: 1 - DRAFT

Page 1 of 1

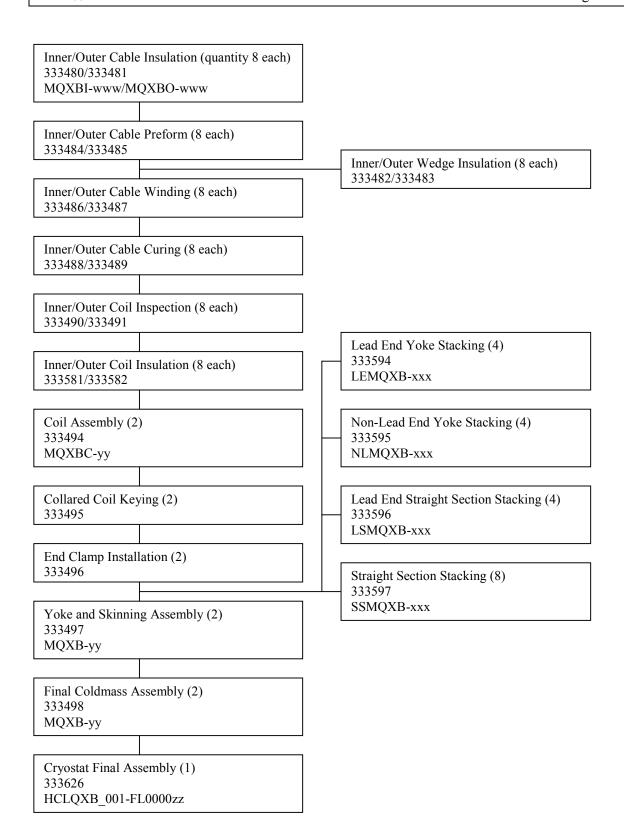

Summary:

- Travelers, OPs and DRs aid to control the production process;
- Documents and records are controlled;
- Inspections are completed throughout the entire process.
- I All the other details are found in the QA Plan.

 THANK YOU